

MX9E11 • S

MX9E111●F

MX9E1 • 12S

#### **PLEASE NOTE**


- This equipment must be installed and maintained by a qualified electrician in accordance with the appropriate statutory regulations and codes of practice.
- All applicable local, regional and national regulations must be complied with during the installation, use, maintenance and replacement of this device.
- This product should not be installed if, when unpacking it, you observe that it is damaged.
- Clipsal cannot be held responsible in the event of noncompliance with the instructions in this document and in the documents to which it refers.
- The service instruction must be observed throughout the life time of this product.

### A A DANGER

### HAZARD OF ELECTRIC SHOCK, EXPLOSION OR ARC FLASH

- Turn off all power supplying this product before working on it.
- Use a voltage tester with a suitable rated voltage in order to check that all active conductors aren't energized.
- Carefully inspect the work area to check that no tools or objects could have been left inside the equipment.

Failure to follow these instructions will result in death or serious injury.

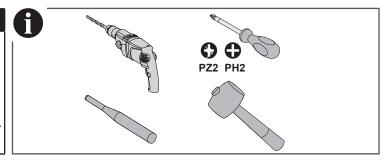

## Unboxing

MX9E11 •• S









				-			b a		
Commercial Reference Number	Green Label-1	Green Label-2	Pole Filler	Instruction Sheet	Screw M3.5	Earth Cable	Cap M8	WHT20 Cap	Cap M10
				NNZ8545201			0		$\bigcirc$
MX9E1111F	1	-	1	1	2	1	1	-	-
MX9E1117F	1	-	1	1	4	1	4	-	-
MX9E1111S	1	-	1	1	-	-	4	6	-
MX9E1117S	1	-	1	1	-	-	4	6	-
MX9E1106S	1	-	1	1	-	-	4	6	-
MX9E1212S	1	-	2	1	-	-	-	12	8
MX9E1312S	1	1	2	1	-	-	-	12	8
MX9EW212S	1	-	2	1	-	-	-	12	8
MX9EW312S	1	1	2	1	-	-	-	12	8




# Removal of Front Cover

### MX9E11 •• S




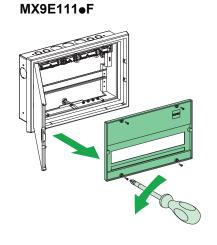

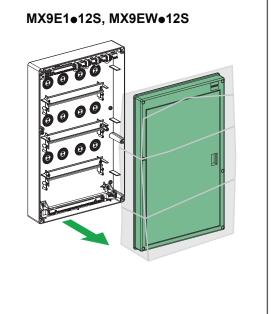

## **Mounting of Enclosures**


Surface Mount: MX9E11●●S

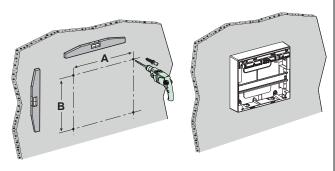



	A (mm)	B (mm)	C (mm)	D (mm)
MX9E1106S	36	172	-	-
MX9E1111S	158	172	-	-
MX9E1117S	240	172	-	-
MX9E1212S	310	320	120	200
MX9E1312S	310	455	187	267
MX9EW212S	310	320	120	200
MX9EW312S	310	455	187	267

**Note:** For surface mount mark the points corresponding to the box keyholes and drill holes accordingly.

### MX9E1•12S, MX9EW•12S

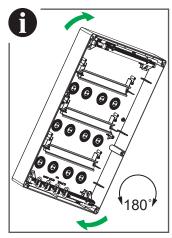




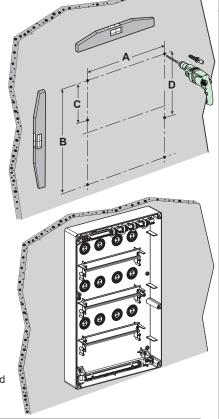

### Flush Mount: MX9E111●F

	E (mm)	F (mm)	G (mm)
MX9E1111F	270	240	82
MX9E1117F	378	240	82

**Note:** For flush mount fix the box in the wall cavity with the outer edges projecting out the wall's surface (marking provided).

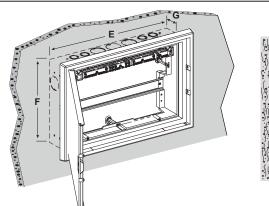




NNZ8545201 2/4




## **Cable Entry Knockouts**


#### **PLEASE NOTE**

- Remove the minimum number of knockouts required for the incoming and outgoing cables to pass through easily.
- IP rating shall be maintained, suitable cable protection shall be applied with appropriate conduit.

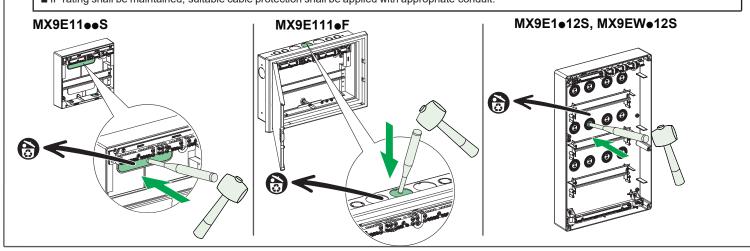


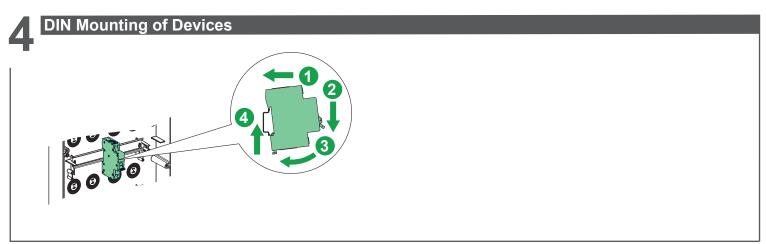

# **Finishing Installation**

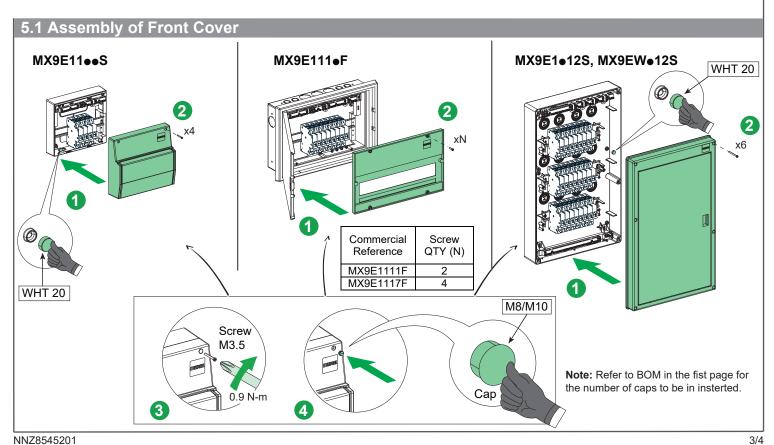

NNZ8545201

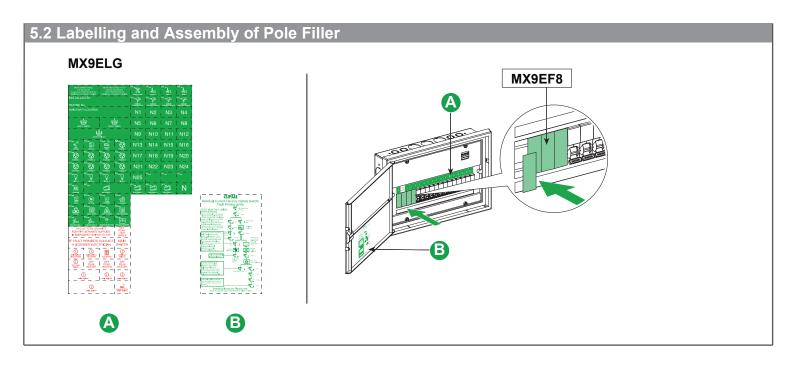

Clipsal by Schneider Electric (Australia) Pty Limited 33-37 Port Wakefield Road Gepps Cross South Australia 5094

Customer Care Centre Tel: 1300 369 233 Email: customercare.au@se.com

Fax: 1300 369 288 www.clipsal.com



